


257.83 (b) (2)	REPORT OF ANNUAL INSPECTION OF CCR SURFACE IMPOUNDMENT		
	FACILITY NAME: Plant Hammond CCR Surface Impoundment AP-2, Permit 057-024D(CCR)		
	OWNER/OPERATOR OF FACILITY: Georgia Power Company		
	INSPECTION DATE: October 25, 2023		
	INSPECTING ENGINEER: Jacob A. Jordan, P.E. (GA PE# PE028586)		
(i)	ANY CHANGES IN GEOMETRY OF THE IMPOUNDING STRUCTURE SINCE THE PREVIOUS ANNUAL INSPECTION?	NO	
	(IF YES, DESCRIBE):		
(ii)	LOCATION AND TYPE OF EXISTING INSTRUMENTATION	SEE ATTACHED PLAN	
(ii)	MAXIMUM RECORDED READING OF EACH INSTRUMENT SINCE PREVIOUS ANNUAL INSPECTION	SEE ATTACHED TABLE	
(iii)	APPROXIMATE MINIMUM, MAXIMUM AND PRESENT DEPTH AND ELEVATION OF THE IMPOUNDED WATER SINCE PREVIOUS ANNUAL INSPECTION		
	MIN. DEPTH: 0 ft	MAX. DEPTH: 23 ft	PRESENT DEPTH: See note (3)
	MIN. ELEVATION: 576	MAX. ELEVATION: 599	PRESENT. ELEVATION: < 595 ⁽²⁾
(iii)	APPROXIMATE MINIMUM, MAXIMUM AND PRESENT DEPTH AND ELEVATION OF CCR SINCE PREVIOUS ANNUAL INSPECTION.		
	MIN. DEPTH: 0 ft	MAX. DEPTH: 15 ft	PRESENT DEPTH: up to 15 ft
	MIN. ELEVATION: 576	MAX. ELEVATION: 585	PRESENT ELEVATION: 585
(iv)	APPROXIMATE STORAGE CAPACITY OF IMPOUNDING STRUCTURE AT TIME OF INSPECTION.	902,000 cy ⁽¹⁾	
(v)	APPROXIMATE VOLUME OF IMPOUNDED WATER AND CCR AT TIME OF INSPECTION	WATER: <20,000 cy ⁽¹⁾	CCR: Approx 80,994 cy ⁽¹⁾
(vi)	ANY APPEARANCE OF AN ACTUAL OR POTENTIAL STRUCTURAL WEAKNESS OF THE CCR UNIT, IN ADDITION TO ANY EXISTING CONDITIONS THAT ARE DISRUPTING OR HAVE THE POTENTIAL TO DISRUPT THE OPERATION AND SAFETY OF THE CCR UNIT AND APPURTENANT STRUCTURES?	NO	
	(IF YES, DESCRIBE):		
(vii)	ANY OTHER CHANGE(S) WHICH MAY HAVE AFFECTED THE STABILITY OR OPERATION SINCE THE PREVIOUS ANNUAL INSPECTION?	NO	
	(IF YES, DESCRIBE):		

(1) Cubic yard estimates are derived by qualified personnel from available information.

(2) Water levels within AP-2 have dropped due to ongoing closure construction activities and the fact that process and wastewaters are no longer sent to the ash pond. Any water present is temporary ponding following rain events.



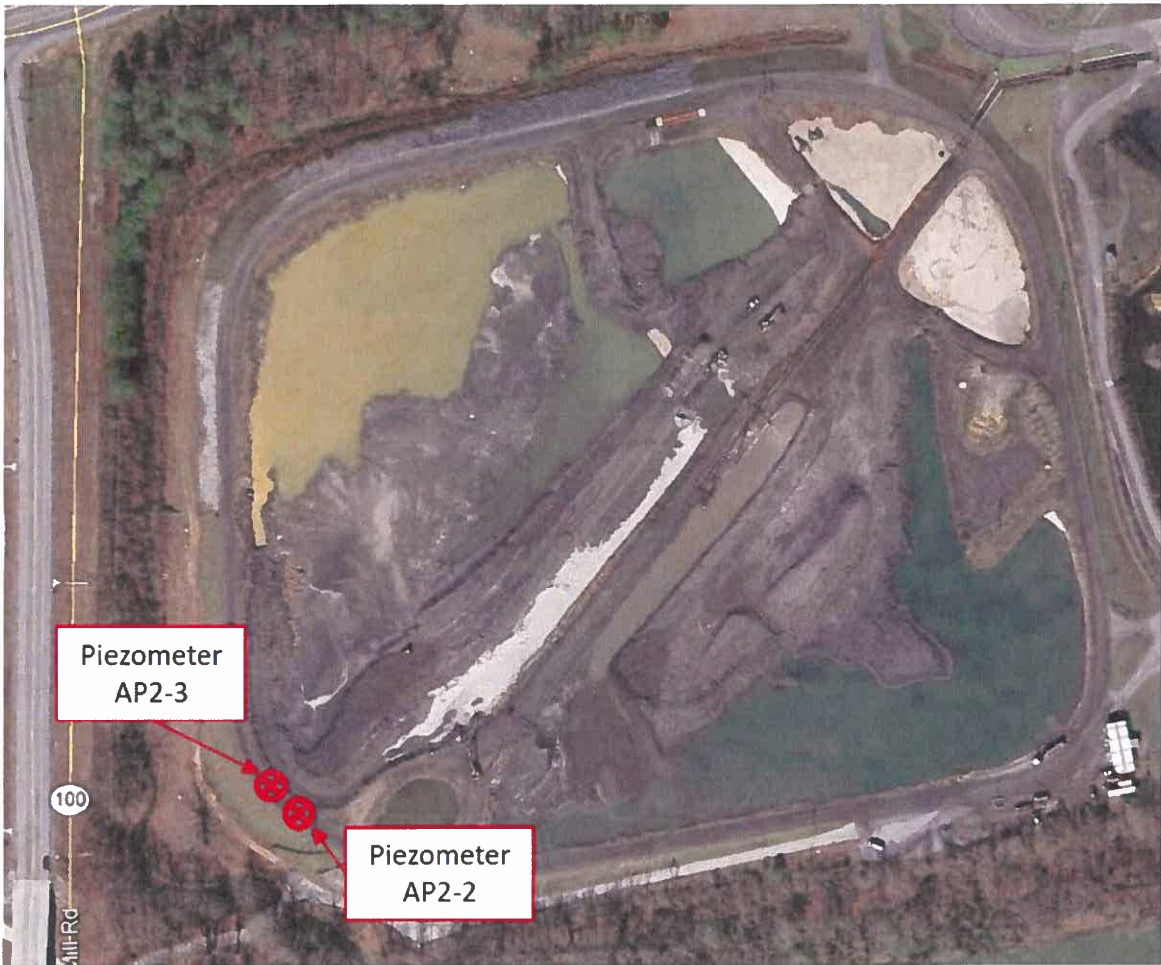

INSTRUMENTATION PLAN PLANT HAMMOND ASH POND 2

INSTRUMENTATION READINGS

PLANT HAMMOND ASH POND 2

PIEZOMETER NUMBER	MAXIMUM RECORDED READING*
AP2-2	EL 583
AP2-3	EL 565

*MAXIMUM RECORDED READING SINCE LAST ANNUAL INSPECTION; ROUNDED TO NEAREST FOOT

