


257.83 (b) (2)	REPORT OF ANNUAL INSPECTION OF CCR SURFACE IMPOUNDMENT		
	FACILITY NAME: Plant McDonough-Atkinson Ash Pond 4 (AP-4), Inactive CCR Surface Impoundment, CCR Permit No. 033-099D(CCR)		
	OWNER/OPERATOR OF FACILITY: Georgia Power Company		
	INSPECTION DATE: May 12, 2026		
	INSPECTING ENGINEER: Patrick B. Rhodes, P.E. (Georgia P.E. License #24586)		
(i)	ANY CHANGES IN GEOMETRY OF THE IMPOUNDING STRUCTURE SINCE THE PREVIOUS ANNUAL INSPECTION?	No	
	(IF YES, DESCRIBE):		
(ii)	LOCATION AND TYPE OF EXISTING INSTRUMENTATION	See Attached Figure	
(ii)	MAXIMUM RECORDED READING OF EACH INSTRUMENT SINCE PREVIOUS ANNUAL INSPECTION	See Attached Chart	
(iii)	APPROXIMATE MINIMUM, MAXIMUM AND PRESENT DEPTH AND ELEVATION OF THE IMPOUNDED WATER SINCE PREVIOUS ANNUAL INSPECTION		
	MIN. DEPTH: 0 ft ⁽¹⁾	MAX. DEPTH: 0 ft ⁽¹⁾	PRESENT DEPTH: 0 ft ⁽¹⁾
	MIN. ELEVATION: N/A	MAX. ELEVATION: N/A	PRESENT ELEVATION: N/A
(iii)	APPROXIMATE MINIMUM, MAXIMUM AND PRESENT DEPTH AND ELEVATION OF CCR SINCE PREVIOUS ANNUAL INSPECTION		
	MIN. DEPTH: 0 ft	MAX. DEPTH: 102 ft	PRESENT DEPTH: Up to 102 ft
	MIN. ELEVATION: EL 762 ft	MAX. ELEVATION: EL 900 ft	PRESENT ELEVATION: Up to EL 900 ft
(iv)	APPROXIMATE STORAGE CAPACITY OF IMPOUNDING STRUCTURE AT TIME OF INSPECTION	243,000 yd³ ⁽²⁾	
(v)	APPROXIMATE VOLUME OF IMPOUNDED WATER AND CCR AT TIME OF INSPECTION	WATER: 0 yd³ ⁽¹⁾	CCR: 3,020,000 yd³ ⁽³⁾
(vi)	ANY APPEARANCE OF AN ACTUAL OR POTENTIAL STRUCTURAL WEAKNESS OF THE CCR UNIT, IN ADDITION TO ANY EXISTING CONDITIONS THAT ARE DISRUPTING OR HAVE THE POTENTIAL TO DISRUPT THE OPERATION AND SAFETY OF THE CCR UNIT AND APPURTENANT STRUCTURES?	No	
	(IF YES, DESCRIBE):		
(vii)	ANY OTHER CHANGE(S) WHICH MAY HAVE AFFECTED THE STABILITY OR OPERATION SINCE THE PREVIOUS ANNUAL INSPECTION?	No	
	(IF YES, DESCRIBE):		

1) The closure cover system is in-place and the CCR unit no longer impounds water. Water present is related to temporary non-CCR stormwater management.

2) Approximate storage capacity of impounding structure is estimated as the total volume from the bottom of AP-4 to the north dam crest elevation of 788 feet.

3) Volume of CCR exceeds the storage capacity due to dry stacking of CCR above elevation 788 feet. This does not pose a safety or operational concern.

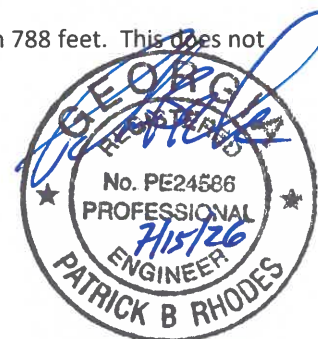

**MAXIMUM RECORDED READINGS OF INSTRUMENTATION
PLANT MCDONOUGH AP-4**

PIEZOMETERS

PIEZOMETER NUMBER ⁽¹⁾	MAXIMUM RECORDED READING ⁽²⁾
P-1	EL 819
P-1A	EL 787
P-2	EL 785
P-6B	EL 779
P-13	EL 780
AP-3	EL 774

- 1) All other piezometers have been abandoned as part of closure.
- 2) Maximum recorded readings since last annual inspection; rounded to the nearest foot.

LATERAL DRAIN AND WEIR FLOWS

DRAIN	MAXIMUM MEASURED FLOW
No. 1 ⁽¹⁾	0.0 gpm

- 1) Drain No. 1 was abandoned March 2024 as part of closure. All other weirs and lateral drains have been abandoned as part of closure.

INSTRUMENTATION LOCATION
PLANT MCDONOUGH AP-4

